PROJECT: SAMS



AET.	REV.	MAME OTY E DRAWING REF. DESIGNATION	FAILUME MODE AND CAUSE	FAILURE EFFECT ON CMD ITEM	HOWR / FUNC.  2/IRAB RATIONALE FOR ACCEPTANCE CRITICALITY
1740	2	RIGIDIZATION MECHANISM PART OF SIL40E1472 - 18-3 QTV-1	MODE: RIGIDIZE BRAKE SLIPS OR DISENGAGED.  CAUSE(S): (I) STRUCTURAL FAILURE. (2) MECHANICAL FAILURE (GUIDE PIN AND SPRING). (3) FRICTION DEBRIS FROM EXCESSIVE BRAKE PAD HEAR.	HONE. SMARE BRAKE HOLDS SYSTEM.  MORST CASE LOSS OF MISSION. SUBSEQUENT FAILURE MAY CAUSE UNCOMMANDED RELEASL.  REDUNDANT PATHS REMAINING  SMARE BRAKE	THE EMD EFFECTOR BRAKE IS A NAJOR BOUGHT-OUT-PART WHICH IS SUPPLIED BY MONEYWELL SPERRY CORPORATION AND HEETS OR EXCEOS THE REQUENTINES OF SPECIFICATION SPARSG. 451 FOR P/N 51140D574 18-7 AND SPAR-SC. 1091 FOR P/N 51140D574 18-7 AND SPAR-SC. 1091 FOR P/N 51140D574 18-7 AND SPAR-SC. 1093 FOR P/N 51140D574 19-7 AND SPARSG. 1093 FOR P/N 51140D574 19-7 AND SPARS
ARED BY:	ME MA	****	EDING DATE: 04 00		DATE:

	•
	·

CRITICAL ITEMS LIST

PROJECT: SRMS ASS'Y MONENCEATURE: END EFFECTOR

ASS'Y P/N: STT40E7470-TE SHEET: 2

FHEA MEF.	REV.	MAME OTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HOWR / FUNC. 2/FRAB RATIONALE FOR ACCEPTANCE CRITICALITY
3740	2.	RIGIDIZATION NECHANISM PART OF 51140E1472 -16-3 QTY-1	MODE: RIGIDIZE BRAKE SLIPS OR DISEMGAGED.  CAUSE(S): (I) STRUCTURAL FAILURE. (2) MELHANICAL FAILURE AND SPRING). (3) FRICTION DEBRIS FROM EXCESSIVE BRAKE PAO MEAR.	HOME. SMARE BRAKE HOLDS SYSTEM.  HORST CASE LOSS OF MISSIOM. SUBSEQUENT FAILURE MAY CAUSE UNCOMMANDED RELEASE.  REDUNDANT PATHS REMAINING  SMARE BRAKE	ENGAGED AND THEN 10 SECONDS DISENGAGED. THE UNITS RECEIVE A VERY LINITED ANDUNT OF SLIPPING DINING ON MISSION USAGE. OF BRIS IS PREVENTED FROM ESCAPING FROM THE -3 CLUTCH USED IN THE SITURD 3 END EFFECTOR WITH A LABYRINTH NETWORK.  THE AIR CAP OF THE UNIT IS VERIFIED TO MEET A MINIMUM VALUE BY THE END PLAY TEST (LARGEST APPLIED LOAD) DURING ACCEPTANCE TESTING.  THE STRIPDOWN AND INSPECTION OF FLIGHT HARDWARE RETURNED FOR REFURBISHMENT HAS REVEALED THAT A SIGNIFICANT ANOUNT OF FRICTION MATERIAL DEBRIS MAY HAVE ACCUMULATED AT THE UNIT ON UP-LIFE. IT IS VALUE UNLIBELY: HOWEVER, THAT SUFFICIENT FRICTION DEBRIS COULD ACCUMULATE BEHIND THE ARRATURE OR BETWEEN THE FRICTION SURFACES. SO RS TO AFFECT THE UNITS PERFORMANCE.
					DMC (MECH = 97

RMS/MECH - 97\_\_\_\_\_

POSPAGEN BY. MEMO

----

PROJECT: SRMS ASS'Y NOMENCLATURE: END EFFECTOR

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/N: STINOETA70-TE: SHEET: 1

THEA REF. REV	HAME QYY A DRAWING RÉF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END LIEM	HDWR / FUNC. 2/IMAB RATIONALE FOR ACCEPTANCE CRITICALITY
3740 2	RIGIDIZATION HECHANISN PART OF 5-1140E 147218-3 QTY-1	MODE: RIGIOIZE BRAKE SLIPS OR DISENGAGED.  CAUSE(S): (I) STRUCTURAL FAILURE. (2) HECHANICAL FAILURE (GUIDE PIN AND SPRING). (3) FRICTION DEBRIS FROM EXCESSIVE BRAKE PAD HEAR.	NONE. SHARE BRAKE HOEDS SYSTEM.  MORST CASE LOSS OF RISSION. SUBSEQUENT FAILURE HAY CAUSE UNCOMMANDED RELEASE.  REDUNDANT PATHS REMAINING  SHARE BRAKE	THE EE ASSEMBLY IS TESTED TO THE FOLLOWING ACCEPTANCE ENVIRONMENTS:  O VIBRATION: LEVEL AND DURATION - REFERENCE TABLE 7  O THERMAL VACUUM: *70 DEGREES C TO -25 DEGREES C (1 1/2 CYCLES)   X 100-6 TORR  THE EE ASSEMBLY 4S FURTHER TESTED IN THE IN THE RMS SYSTEM TEST (TPS10 RMS STRONGBACK AND TPS52 FLAT FLOOR TESTS) WHICH VERVITES INL ABSENCE OF THE FOLLOWING ENVIRONMENTS: ;  O VIBRATION LEVEL AND DURATION - REFERENCE TABLE 7  O SHOCK': 20G/11 MS - 3 AYES (6 DIRECTIONS)  O THERMAL VACUUM: *80 DEGREES C TO -36 DEGREES C (6 CYCLES)   X 100-6 TORR  O HUNIDITY: 95% RM (65 DEGREES C MAINTAINED FOR 6 HRS) (65 DEGREES C TO 10 DEGREES C IN 16 HRS) IN CYCLES 240 HRS.  O EMC: MIL-STO-461A AS MODIFIED BY SL-E-0002 (TEST CEOI, CEO3, CSO1, CSO2, CSO6, REO? (N/8))  O STRUCTURAL STOFFMESS AND LOAD TEST  FLIGHT CHECKOUT  PDRS OPS CHECKLIST (ALL VENICLES) JSC 16987

PREPARED ST: MENG

SUPERCEDING DATE: 06 OCT 07 APPROVED BY:

## CRITICAL ITEMS LIST

PROJECT: SRMS
ASS'Y NOMERCLATURE: END EFFECTOR

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/R: \$1140E1470-1E:3 | SHEET: 4

FHEA REF.	REV.	DRAWING REF. DESIGNATION	CAUSE HODE	FAILURE EFFECT ON END ITEM	HOMR / FUNC.  2/ IRAB  RAYLONALE FOR ACCEPTANCE
ARED BY:		AIGIDIZATION MECHANISH PART OF SITAOCIATZ -IA-J QTY-I	MODE: RIGIDIZE BRAKE SLIPS OR DISENGAGED.  CAUSE(S): (1) STRUCTURAL FAILURE (GUPDE PIN AND SPRING) (2) FRICTION DEBRIS FRON EXCESSIVE BRAKE PAD MEAR.	MONE. SNARE BRAKE HOLDS SYSTEM.  WORST CASE LOSS OF MISSION. SUBSEQUENT FAILURE MAY CAUSE UNCOMMANDED RELEASE.  REDUNDANT PATHS REMAINING SNARE BRAKE	CRITICALITY  QA/IMSPECTIONS  UNITS ARE HANUFACTURED UNDER DOCUMENTED QUALITY CONTROLS. THESE CONTROLS ARE EXERCISED PHONOUPHOUT DESIGN PROCURERENT PLANNING, RECEIVING, PROCESSING, FABRICATION, ASSEMBLY, TISTING AND SHIPPING OF THE UNITS. HANDAIGNY ASSEMBLY, TISTING SHE EXPLOYED AND HAIR OF THE UNITS. HANDAIGNY ASSEMBLY AND SHIPPING OF THE UNITS. HANDAIGNY ASSEMBLY AND SHORE AT VARIOUS CONTROL LEVELS.  RECEIVING INSPECTION VERIFIES THAT THE HANDWARE RECEIVED IS AS LOSENIFIED IN THE PROJUGICAL AND HOLD AND AND AND AND AND AND AND AND AND AN
_			DING DATE: 06 OC	T 97 APPROVED B	1.

APPROVED BY: \_

DMC /327

PROJECT: SAMS
ASS'Y MOMENCEATURE: END EFFECTOR

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/N: STTADETATO-TE-3 SHEET: \_\_\_\_\_\_\_

MEA NEF. NEV.	NAME OTY B DRAWING REF. DESIGNATION	FAILURE MODE FAILURE EFFECT AND ON END STEM	2/IRAB RATIONALE FOR ACCEPTANCE CRITICALITY
3740 2 -	RIGIDIZATION MECHANISM PART OF 51140E1472 -18-3 QTY-1	MODE: RIGIDIZE BRAKE SLIPS ON DISENGAGED.  CAUSE(S): (I) STRUCTURAL FAILURE. (2) MECHANICAL FAILURE (GUIDE PIN AND SPRING). (3) FRICTION DEBRIS FROM EXCESSIVE BRAKE PAD MEAR.	A TEST READINESS REVIEW (TRR) WHICH INCLUDES VERIFICATION OF TEST PERSONNEL TEST DOCUMENTS. TEST EQUIPMENT CAL-BRATION/VALIDATION STATUS AND MARDHARE CONFIGURATION ACCOMPENDED BY QUALITY ASSURANCE IN CONJUNCTION WITH EMCINEERING RELIABILITY. CONFIGURATION CONTROL. SUPPLIER AS APPLICABLE. AND THE GOVERNEW FERRESHMATHY. PRIOR TO THE START OF ANY FORMAL TESTING (ACCEPTANCE ON QUALIFICATION).  ACCEPTANCE TESTING (ATP) INCLUDES, ANDIEMT, VIBRATION AND THERMAL VAC TESTING, (SPAR/GOVERNMENT REP.— MANDATORY INSPECTION POINT)  SAMS SYSTEMS INTEGRATION. THE INTEGRATION OF MECHANICAL ARM SUBASSEMBLES AND THE FLIGHT CABIN QUIPMENT TO FORM THE SAMS. INSPECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION WHICH INCLUDES GROUNDING CHECKS. THOU WITHIN CHICKS. WHING ROUTING, WHITEITAGE CONNECTIONS FOR BENT OR PUSH BACK CONTACTS ETC.  SRMS SYSTEMS TESTING - STRONGBACK AND FLAT FLOOR AMBIENT PERFORMANCE TEST. (SPAR/GOVERNMENT REP.— MANDATORY INSPECTION POINT)

SUPERCEDING DATE: 06 OCT 87 PREPARED BY: WHE

APPROVED BY: \_

## CRITICAL ITEMS LIST

PROJECT: SAMS
ASS'Y MOMERICEATURE: END EFFECTOR
ASS'Y P/N: 2

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/N: 5114061470-18-3 SHEET: 6

TREA REF.	REV.	DRAVÍNG RÉF. DESIGNATION	FATLURE MUDE AND CAUSE	FATEURE EFFECT ON END LIEM	NOWR / FUNC. 2/1RAB RATIONALE FOR ACCEPTANCE CRITICALITY
3740	3	RIGIDIZATION NECRANISM PART OF 51140E1472 - 18-3 GTY-1	MODE: RIGIDIZE BRAKE SLIPS OR DISENGAGED.  CAUSE(S): (Î) STRUCTURAL FAILURE. (2) MECHANICAL FAILURE (GUIDE PIN AND SPRING). (3) FRICTION DEBRIS FROM EXCESSIVE BRAKE PAD WEAR.	NOME. SHARE BRAKE HOLOS SYSTEM.  LOSS OF MISSION. SUBSEQUENT FAILURE MAY CAUSE UNCOMMANDED RELEASE.  REDUNDANT PATHS REMAINING  SMARE BRAKE	FAILURE HISTORY  THE FOLLOWING FAILURE ANALYSIS REPORT(S) ARE RELEVANT:  FAR 2404: 5 UNITS (5/MS 301, 302, 303, 304, 305) E/E BRAKE AUG. B7  DESCRIPTION  ALL UNITS FAILED DROP-OUT & RELEASE TIME DUE TO A DESIGN ERROR  CURRECTIVE ACTION  MODIFIED DUG. TO ASSURE CORRECT GAP LENGTH. MODIFIED  CALIBRATION PROCEDURE (WHICH SERVES AS A M.1.P.).

PREPARED BY: NEWS SUPERCEDING DATE: 12 OCT 89 APPROVED BY:

IE: \_\_\_\_\_

PROJECT: SRMS ASS'V MONENCERTURE: END EFFECTOR

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/M: STEED 470-16.] SHEET: 1

REF.	MEV.	PARTING REF.	CAUSE AMD CAUSE	TAILUME EFFECT ON END LIEN	HOUR / FUNC. 2/FRAB RATIONALE FOR ACCEPTANCE CRITICALITY
3740	2	RIGIDIZATION PECHANISM PART OF 31140E 1472 -16-1 QTV-1	MODE: RIGIDTE BRANE SEIPS OR BISENCACED.  CAUSE(S): (I) SERVETURAL FAILURE (C) RECHARALAL FRICURE (GUIDE PIN AND SPRING). (3) PRICTION BERRIS FROM ENCESSIVE BRANE PAD UEAR.	MONE. SNARE BRAKE HOLDS SYSTEM.  MORST CASE LOSS OF RISSION. SUBSCOUTHF FAILUME HAT CAUSE UNCOMMANDED RELEASE. REDUNDANT PAINS REHAINING  SNARE BRAKE	OPERATIONAL EFFECTS  MOME, FOR SUBSEQUENT FAILURE PAYLOAD MILE DE RELEASED METH MO OPERATOR COMMAND. IF INIS OCCURS MINIET THE ARM IS DE INC. DRIVER, THE PAYLOAD MILE TAKE AN UNE PPECTED TRAJECTORY.  CREM ACTION  MANEUVER ARM AND ORBITER ANAT FROM PAYLOAD.  LINLE INAINIM.  THE CREW MILL BE TRAINED TO MANEUVER THE ORBITER ANAY FROM A FREE PAYLOAD AT ART TIME DIRTING ARM OPERATIONS.  PHISSION COMSTRAINT  SPEC OPERATE UNDER VERNIER MATES METHIN 10 FT OF STRUCTURE. THE OPERATOR MUST BE ABLE TO DETECT THAT THE ARMYPAYLOAD IS RESPONDING PROPERT TO COMMANDS VIA MINDOM AND/OR CETY VIEWS  DURING ALL ARM OPTRATIONS.  SCREEN FAILURES  A: EE OPERATES MORRALLY METH LOSS OF REDUNDANCY. INDEPENDANT PATHS MOT TRESTRUMENTED.  D: SAME AS A.  OWNED OFFLINE  NOME  OWNED ONLINE INSTRUMENTED.  MOME
PREPARED I	T: [7]		INCESIM DATE: 14	TET 87 MPRO	TEO 81;

RMS/MECH - 102